Prexiso AG
Europastrasse 27
CH-8152 Glattbrugg
www.prexiso.com

PREXISO

Table of Contents

Instrument Set-up ---- **2**
Overview ---- 2
Display ---- 2
Insert batteries ---- 2
Operations ---- **3**
Switching ON/OFF ---- 3
Clear ---- 3
Message Codes ---- 3
Adjusting measuring reference ---- 3
Multifunctional endpiece ---- 3
Unit setting ---- 3
Measuring Functions ---- **4**
Measuring single distance ---- 4
Permanent measuring ---- 4
Add / Subtract ---- 4
Area ---- 5
Volume ---- 5
Pythagoras (2-point) ---- 6
Pythagoras (3-point) ---- 6
Memory (last 10 values) ---- 7
Technical Data ---- **8**
Message Codes ---- **8**
Care ---- **8**
Disposal ---- **8**
Warranty ---- **8**
Safety Instructions ---- **9**
Symbols used ---- 9
Permitted use ---- 9
Prohibited use ---- 9
Hazards in use ---- 9
Limits of use ---- 9
Areas of responsibility ---- 10
Electromagnetic Compatibility (EMC) ---- 10
FCC statement (applicable in U.S.) ---- 10
Laser classification ---- 10
Labelling ---- 11

Instrument Set-up

Overview

The safety instructions and the user manual should be read through carefully before the product is used for the first time.

The person responsible for the product must ensure that all users understand these directions and adhere to them.

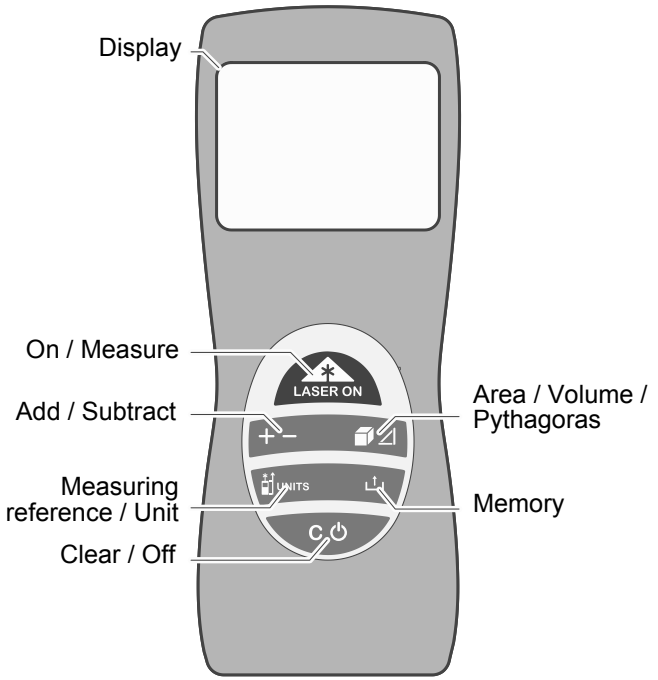

Display

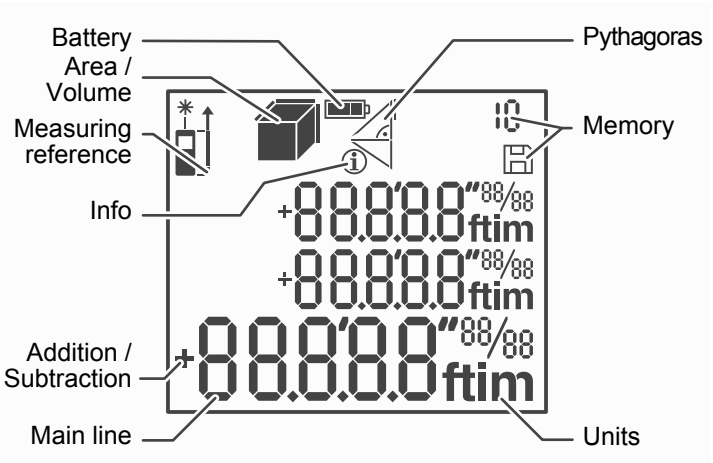

Insert batteries

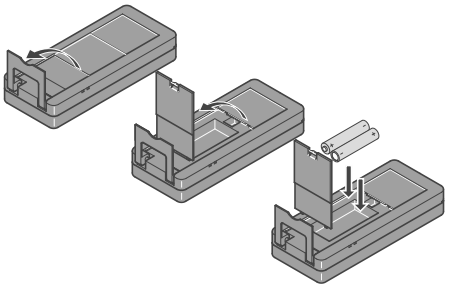

To ensure reliable use, do not use zinc-carbon batteries. Change batteries when battery symbol is flashing.

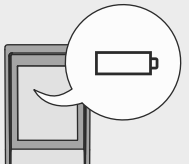

Operations

Switching ON/OFF

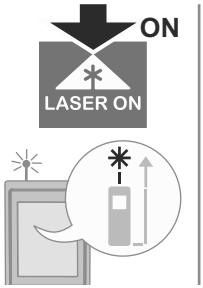

2 sec

Device is turned OFF.

If no key is pressed for 180 sec, the device switches off automatically.

Clear

Undo last action.

Message Codes

If the message **InFo** appears with a number, observe the instructions in "Message Codes" section.
Example:

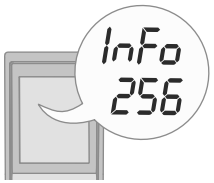

Adjusting measuring reference

1

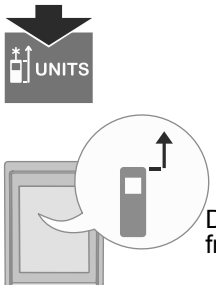

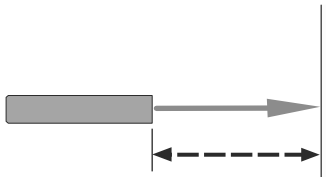

Distance is measured from the front of the device.

2

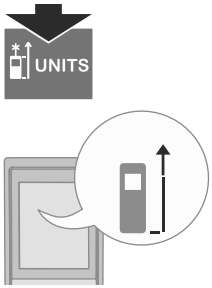

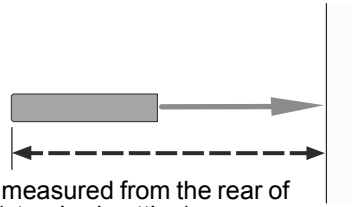

Distance is measured from the rear of the device (standard setting).

Multifunctional endpiece

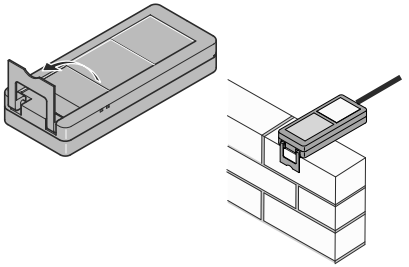

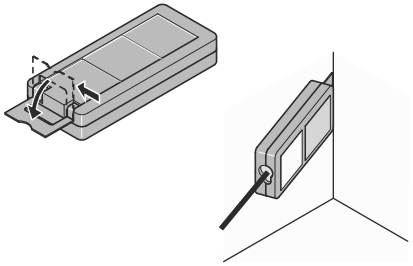

The orientation of the endpiece is automatically detected and the zero point is adjusted accordingly.

Unit setting

2 sec

Switch between the following units:

0.000 m
0‘00“ 1/16
0 in 1/16

Measuring Functions

Measuring single distance

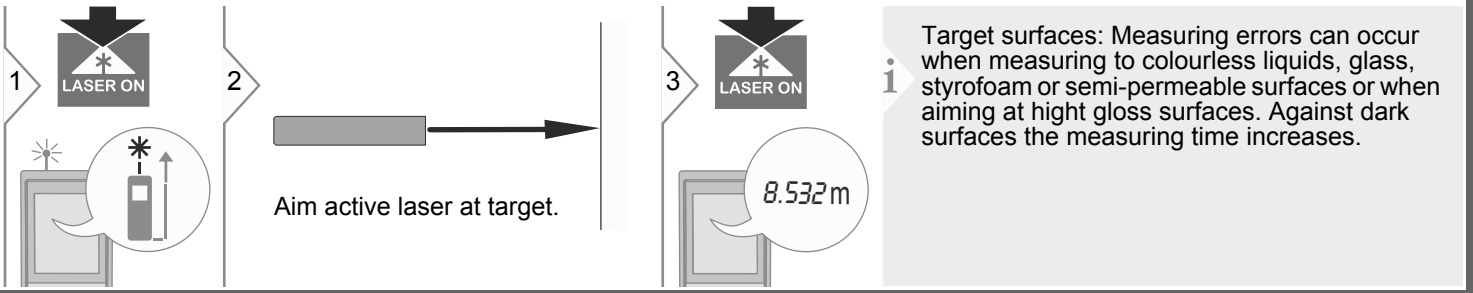

Target surfaces: Measuring errors can occur when measuring to colourless liquids, glass, styrofoam or semi-permeable surfaces or when aiming at hight gloss surfaces. Against dark surfaces the measuring time increases.

Permanent measuring

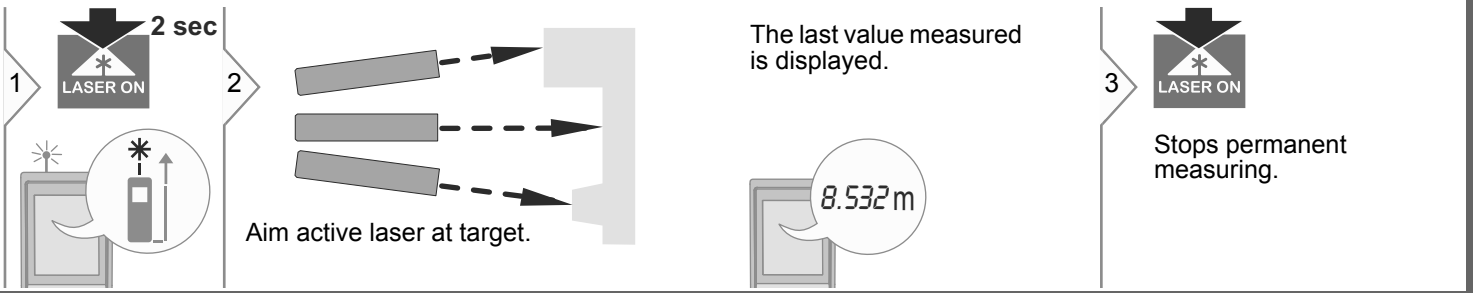

Stops permanent measuring.

Add / Subtract

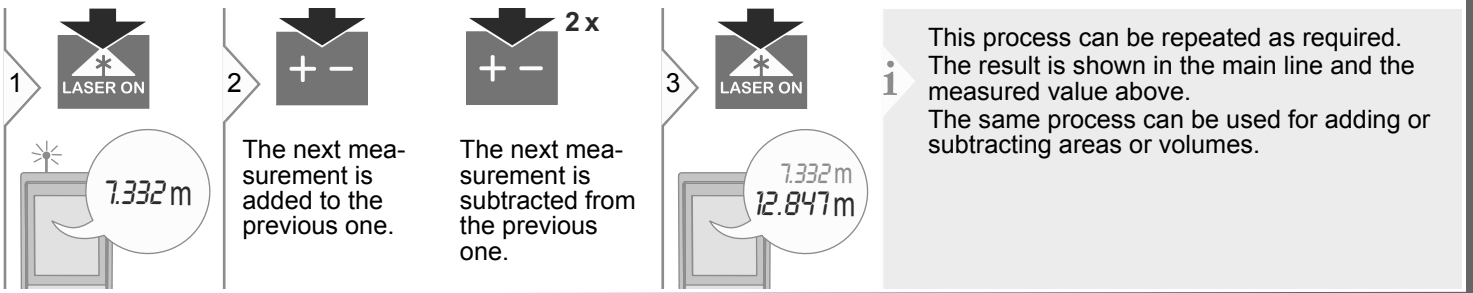

This process can be repeated as required.
The result is shown in the main line and the measured value above.
The same process can be used for adding or subtracting areas or volumes.

Measuring Functions

Area

1

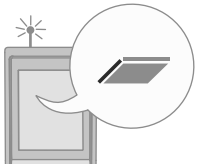

2

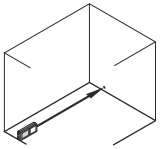

Aim laser at first target point.

3

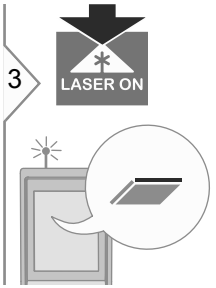

4

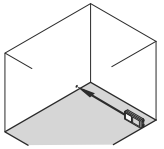

Aim laser at second target point.

5

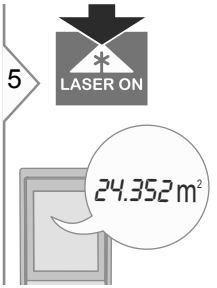

The result is shown in the main line and the measured distance above.

Volume

1

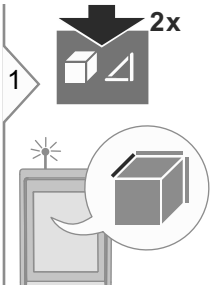

2

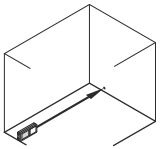

Aim laser at first target point.

3

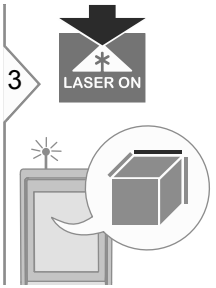

4

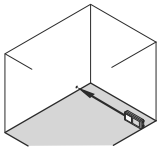

Aim laser at second target point.

5

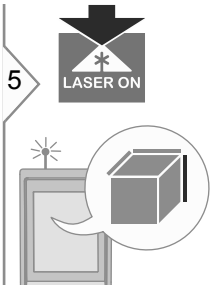

6

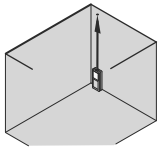

Aim laser at third target point.

7

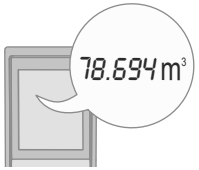

The result is shown in the main line and the measured distance above.

Measuring Functions

Pythagoras (2-point)

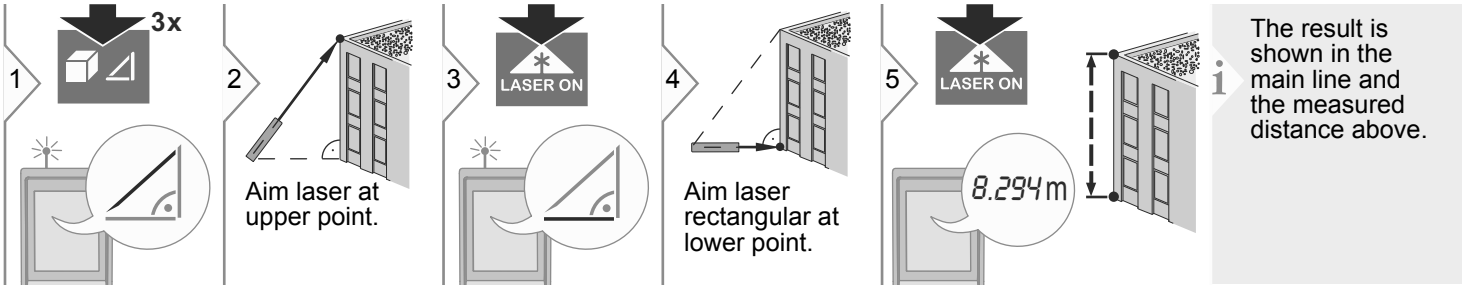

Pythagoras (3-point)

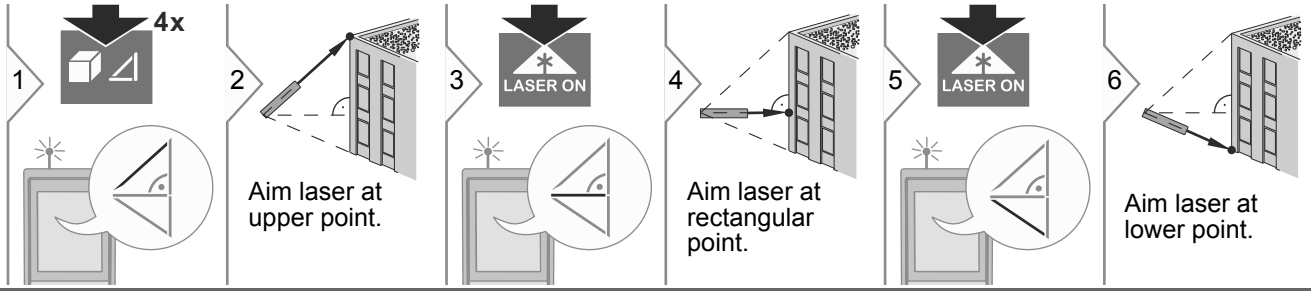

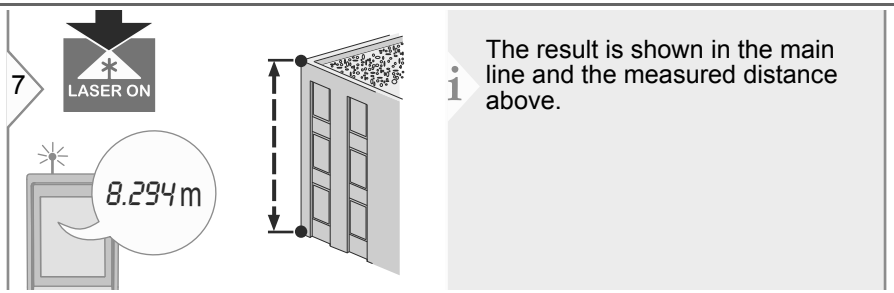

Measuring Functions

Memory (last 10 values)

1

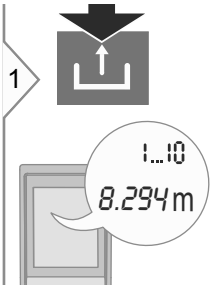

Last 10 values are displayed.

2

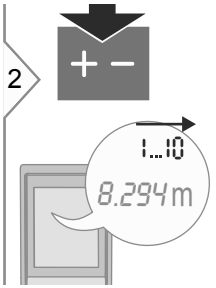

Navigates back through last 10 values.

3

Value is ready to use for further calculations.

Technical Data

General	
Range	0.05 to 80 m 0.16 to 262 ft
Measuring accuracy*	typ.: ± 1.5 mm ± 0.06 in
Smallest unit displayed	1 mm 1/16 in
Laser class	2
Laser type	635 nm, < 1 mW
Protection class	IP54 (dust- and splash water protected)
Autom. power switch-off	after 180 s
Permanent measuring	yes
Addition/Subtraction	yes
Dimension (H x D x W)	117 x 57 x 32 mm 4.6 x 2.4 x 1.3 in
Battery durability (2 x AAA)	up to 3000 measurements
Weight (without batteries)	105 g / 3.38 oz
Temperature range:	
- Storage	-25 to 70 °C -13 to 158 °F
- Operation	0 to 40 °C 32 to 104 °F

* maximum deviation occurs under unfavourable conditions such as bright sunlight or when measuring to poorly reflecting or very rough surfaces. Measuring accuracy between 10 m and 30 m may deteriorate to approx. ±0.15 mm/m, for distances above 30 m to ±0.2 mm/m.

Message Codes

If the message **Error** does not disappear after switching on the device repeatedly, contact the dealer.
If the message **InFo** appears with a number, press the Clear button and observe the following instructions:

No.	Cause	Correction
204	Calculation error	Perform measurement again.
252	Temperature too high	Let device cool down.
253	Temperature too low	Warm device up.
255	Received signal too weak, measuring time too long	Change target surface (e.g. white paper).
256	Received signal too high	Change target surface (e.g. white paper).
257	Too much background light	Shadow target area.
258	Measurement outside of measuring range	Correct range.
260	Laser beam interrupted	Repeat measurement.

Care

- Clean the device with a damp, soft cloth.
- Never immerse the device in water.
- Never use aggressive cleaning agents or solvents.

Disposal

⚠ CAUTION

Flat batteries must not be disposed of with household waste. Care for the environment and take them to the collection points provided in accordance with national or local regulations.
The product must not be disposed with household waste.
Dispose of the product appropriately in accordance with the national regulations in force in your country.

Adhere to the national and country specific regulations.
Product specific treatment and waste management can be downloaded from our homepage.

Warranty

The device comes with a 1-year warranty. For further information contact your dealer.

Safety Instructions

The person responsible for the instrument must ensure that all users understand these directions and adhere to them.

Symbols used

The symbols used have the following meanings:

⚠ WARNING

Indicates a potentially hazardous situation or an unintended use which, if not avoided, will result in death or serious injury.

⚠ CAUTION

Indicates a potentially hazardous situation or an unintended use which, if not avoided, may result in minor injury and/or appreciable material, financial and environmental damage.

i Important paragraphs which must be adhered to in practice as they enable the product to be used in a technically correct and efficient manner.

Permitted use

- Measuring distances

Prohibited use

- Using the product without instruction
- Using outside the stated limits
- Deactivation of safety systems and removal of explanatory and hazard labels
- Opening of the equipment by using tools (screwdrivers, etc.)
- Carrying out modification or conversion of the product
- Use of accessories from other manufacturers without express approval
- Deliberate dazzling of third parties; also in the dark
- Inadequate safeguards at the surveying site (e.g. when measuring on roads, construction sites, etc.)
- Deliberate or irresponsible behaviour on scaffolding, when using ladders, when measuring near machines which are running or near parts of machines or installations which are unprotected
- Aiming directly in the sun

Hazards in use

⚠ WARNING

Watch out for erroneous measurements if the instrument is defective or if it has been dropped or has been misused or modified. Carry out periodic test measurements. Particularly after the instrument has been subject to abnormal use, and before, during and after important measurements.

⚠ CAUTION

Never attempt to repair the product yourself. In case of damage, contact a local dealer.

⚠ WARNING

Changes or modifications not expressly approved by Prexiso for compliance could void the user’s authority to operate the equipment.

Limits of use

i Refer to section "Technical data".

The device is designed for use in areas permanently habitable by humans. Do not use the product in explosion hazardous areas or in aggressive environments.

Safety Instructions

Areas of responsibility

Responsibilities of the manufacturer of the original equipment:

Prexiso AG
Europastrasse 27
CH-8152 Glattbrugg
Internet: www.prexiso.com
The company above is responsible for supplying the product, including the User Manual in a completely safe condition.
The company above is not responsible for third party accessories.

Responsibilities of the person in charge of the instrument:

- To understand the safety instructions on the product and the instructions in the User Manual.
- To be familiar with local safety regulations relating to accident prevention.
- Always prevent access to the product by unauthorised personnel.

Electromagnetic Compatibility (EMC)

⚠ WARNING
The device conforms to the most stringent requirements of the relevant standards and regulations.
However, the possibility of causing interference in other devices cannot be totally excluded.

FCC statement (applicable in U.S.)

This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation.This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications.
However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult the dealer or an experienced radio/TV technician for help.

Laser classification

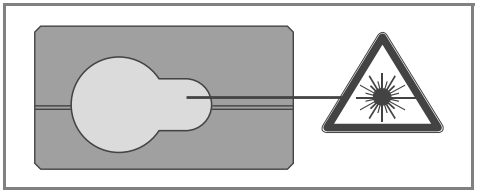

The device produces visible laser beams, which are emitted from the instrument:

It is a Class 2 laser product in accordance with:

- IEC60825-1 : 2007 „Radiation safety of laser products“

Laser Class 2 products:

Do not stare into the laser beam or direct it towards other people unnecessarily. Eye protection is normally afforded by aversion responses including the blink reflex.

⚠ WARNING
Looking directly into the beam with optical aids (e.g. binoculars, telescopes) can be hazardous.

⚠ CAUTION
Looking into the laser beam may be hazardous to the eyes.

Safety Instructions

Labelling

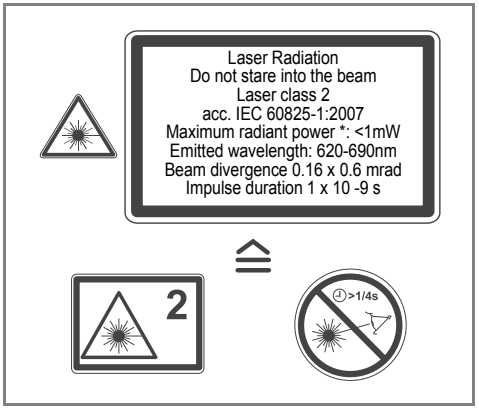

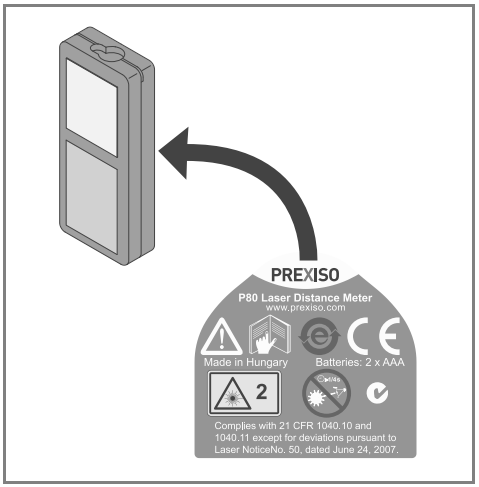

Subject to change (drawings, descriptions and technical data) without prior notice.